

## WorldWEIGH C100 Counting Scale Local Base Calibration Procedure

- Hold “Zero” key while powering on, display will show “Pin”
- Type “0000”, then press “Tare”
- Display shows “tECH LoCAL”, press “Tare”
- Display shows “tECH Unit”, press “Tare”
- Display shows “UnLoAd”, press “Tare”
- Display shows “SEL 000010 b”. Press “CE”, type in the weight to be applied via the numeric keypad, then press “Tare”
- Display shows “LoAD”. Apply weight to the pan, and then press “Tare”
- Unit will save calibration and re-boot automatically, calibration complete.